

Date: Thursday, 10/07/2008 12:44:30 PM
User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	350/355 AS X-TUBE AFT UNDER REVIEW	
Job Number :	40412			
Estimate Number :	12486			
P.O. Number :		Part Number :	D350748201	
This Issue :	10/07/2008	S.O. No. :		
Prsht Rev. :	NC	Drawing Number :	N/A	
First Issue :	/ /	Project Number :	N/A	
Previous Run :	40411	Drawing Revision :	D	
	Type :	Material :		
	CROSSTUBES	Due Date :	31/08/2008	Qty: 1 Um: Each
Written By :				
Checked & Approved By :	JLD 08.7.10			
Comment :	Est Rev: A New Issue 06-07-05 JLM Est Rev: B Update qty of MS21042L5 06-09-12 KJ Est Rev C Combined manufacturing 08.04.02 EC verified by: DD Est Rev:D 08-06-24 revD as per dwg DD verified by:EC			

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



JLD 08.8.13



Comment: Photocopy bluefile & type labels per PPPD350-748-201 CHG001

2.0	D350748241TRN	Crosstube Turning Detail
-----	---------------	--------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
CROSSTUBE TURNING DETAIL
batch B38007

DP 8-7-10

3.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------



Comment: BENDING MACHINE
Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio FT

DP 8-7-10

4.0	QC15	DIMENSIONAL CHECK OF X-TUBES
-----	------	------------------------------



Comment: DIMENSIONAL CHECK OF X-TUBES

JLD 08.7.11

5.0	CROSSTUBES	CROSSTUBES RESOURCE 1
-----	------------	-----------------------



Comment: LANDING GEAR RESOURCE 1
1-Remove all marks from tube within limits of D350-748-241
2-Drill Tube as per Dwg D350-748-241 Using DT8876 Drill Jigs,
Set-up drill table as per QSI 010

- ANM 8-7-14
JLD 08.07.14

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
				✓				

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 12:44:30 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT UNDER REVIEW

Job Number: 40412

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

3-Deburr

4-Engrave Part # and Batch # as per Dwg D350-748-241

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

508/07/15 @

7.0

OUTSIDE SERV.10

OUTSIDE SERVICES -skids



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: 6784

Stress relief at 375° for 5 hours

Magnetic Particle Inspect per ASTM E1444

Cadium Plate per AMS-QQ-P-416B, Class 1, Type 2

Embrittle relief at 375° for 8 hours, Chromate Treat

Possible Supplier: Southwest United Industries

Ensure Certificate of Conformity is attached

C208/07/16 @

8.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage

Ensure certificate of conformity is attached

AS 08/08/11 @

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 08/08/11 @

10.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside crosstube as per QSI 005 4.2

2-Paint Outside of Tube as per Dart QSI 005 4.2

IT 08-08-15

11.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

ml 08 08 21

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 12:44:30 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT UNDER REVIEW

Job Number: 40412

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2401 f(s)/Unit Total : 1.2401 f(s)

Abrasion Strip 7.10" long x2

Batch: 37667

ml 08 08 21

13.0

ALS41032225

Insert



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Insert

Batch: 100489

ml 08 08 21

14.0

AN960JD10

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Washer

Batch: 108558

ml 08 08 21

15.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Clamp (per MIL-DTL-8783C)

Batch: 106484

ml 08 08 21

16.0

MS27039110

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Screw

Batch: 108986

ml 08 08 21

17.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install Ground wire Insert, then insert screw and washer

2-Install Abrasion strips as per Dwg D350-748-241 & QSI 035.

3-Install supports Using Dt8876 as per Dwg D350-748-241, Torque to 60-80 IN-LBS

ml 08 08 21 (1)

Support D3502-1 B 32205 ml 08 08 21

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 12:44:30 PM.
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT UNDER REVIEW

Job Number: 40412

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/08/21 (4)

19.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

20.0

D35001

Saddle



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

350 SADDLE

Batch: B35315

B35781

SC

21.0

D35021

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

SUPPORT

Batch: B32201

35316

change to seq. 12

U

22.0

D35011

Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

BUSHING

Batch: B32201

35316

SC

23.0

AN46A

Bolt



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

Bolt

Batch: M107534

SC

24.0

AN441A

bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

bolt

Batch: M105940

M106302

8/8/22

SC

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 12:44:30 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT UNDER REVIEW

Job Number: 40412

Part Number: D350748201

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

25.0	AN532A	Bolt
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M107013

SC

26.0	AN960JD416	Washer
------	------------	--------



Comment: Qty.: 32.0000 Each(s)/Unit Total : 32.0000 Each(s)

Washer

Batch: M108161

SC

27.0	AN960JD516	Washer
------	------------	--------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Washer

Batch: M108246

SC

28.0	MS21042L4	Nut
------	-----------	-----



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Nut

Batch: 107499

SC

28.0	MS21042L5	Nut
------	-----------	-----



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch: M108471

(1x)

SC

30.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
------	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

8/8/22
1008.21 (1)

31.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-201

Location:

PPP Rev: A

8/8/22

(1x)
SC

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 12:44:30 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT UNDER REVIEW

Job Number: 40412

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

QC21

FINAL INSPECTION/W/O RELEASE



08/08/25 *[Signature]*

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-08-22

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	40412
Description: Crosstube High Aft (AS350/355)		Part Number:	D350-748-201
Inspection Dwg: D350-748-241 Rev: D		Page 1 of 1	

Required Dimension	Min	Max
Height	31.22	31.48
1/2 Span	40.77	41.03
Angle	75	77
Total Span	81.54	82.06

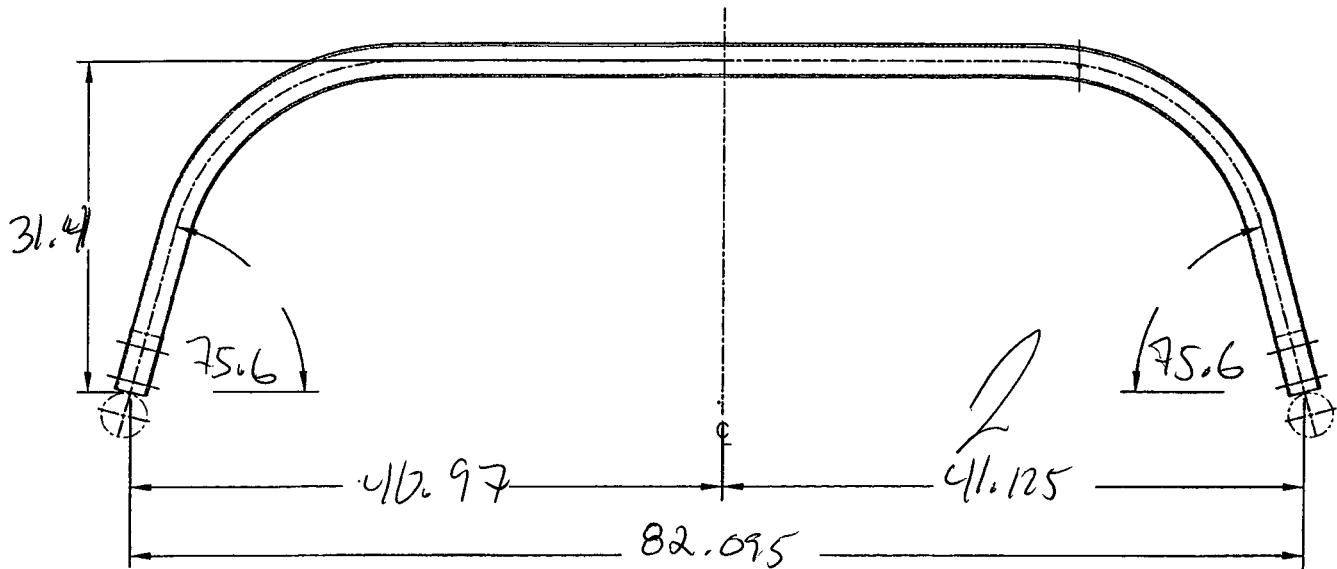

Comments

QC15 Inspection	08/11
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART**RELEASED**

06.10.31

DESIGN 9P	DRAWN BY 9P	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED H	APPROVED H	DRAWING NO. D350-748-241	REV. D SHEET 1 OF 3
DATE 06.10.31		TITLE CROSSTUBE (AS 350/355 HI AFT) NTS	
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6018-125 & PRIME AND PAINT	
C	06.08.14	ADD CAD PLATING	
D	06.10.31	MAG. PARTICLE AND CAD PLATE AS MFD.	

QTY	P/N	DESCRIPTION
X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
1	D6018-125	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
1	MS27039-1-10	SCREW

D350-748-141 CROSSTUBE:

- 1) MATERIAL: MANUFACTURED FROM D6018-125 OR D6015-125
FINISHED LENGTH = 122.70±0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 5) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING.
- 6) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 7) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 8) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 9) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 10) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 11) ALL DIMENSIONS ARE IN INCHES
- 12) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR Ø0.297 HOLE.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40412

UNDER REVIEW

07.03/16
CUFF JENK REDUCED
OK 07.11.22

Copyright © 2006 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ **PAR #:** _____ **Fault Category:** _____ **NCR: Yes No** **DQA:** _____ **Date:** _____
QA: N/C Closed: _____ **Date:** _____



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

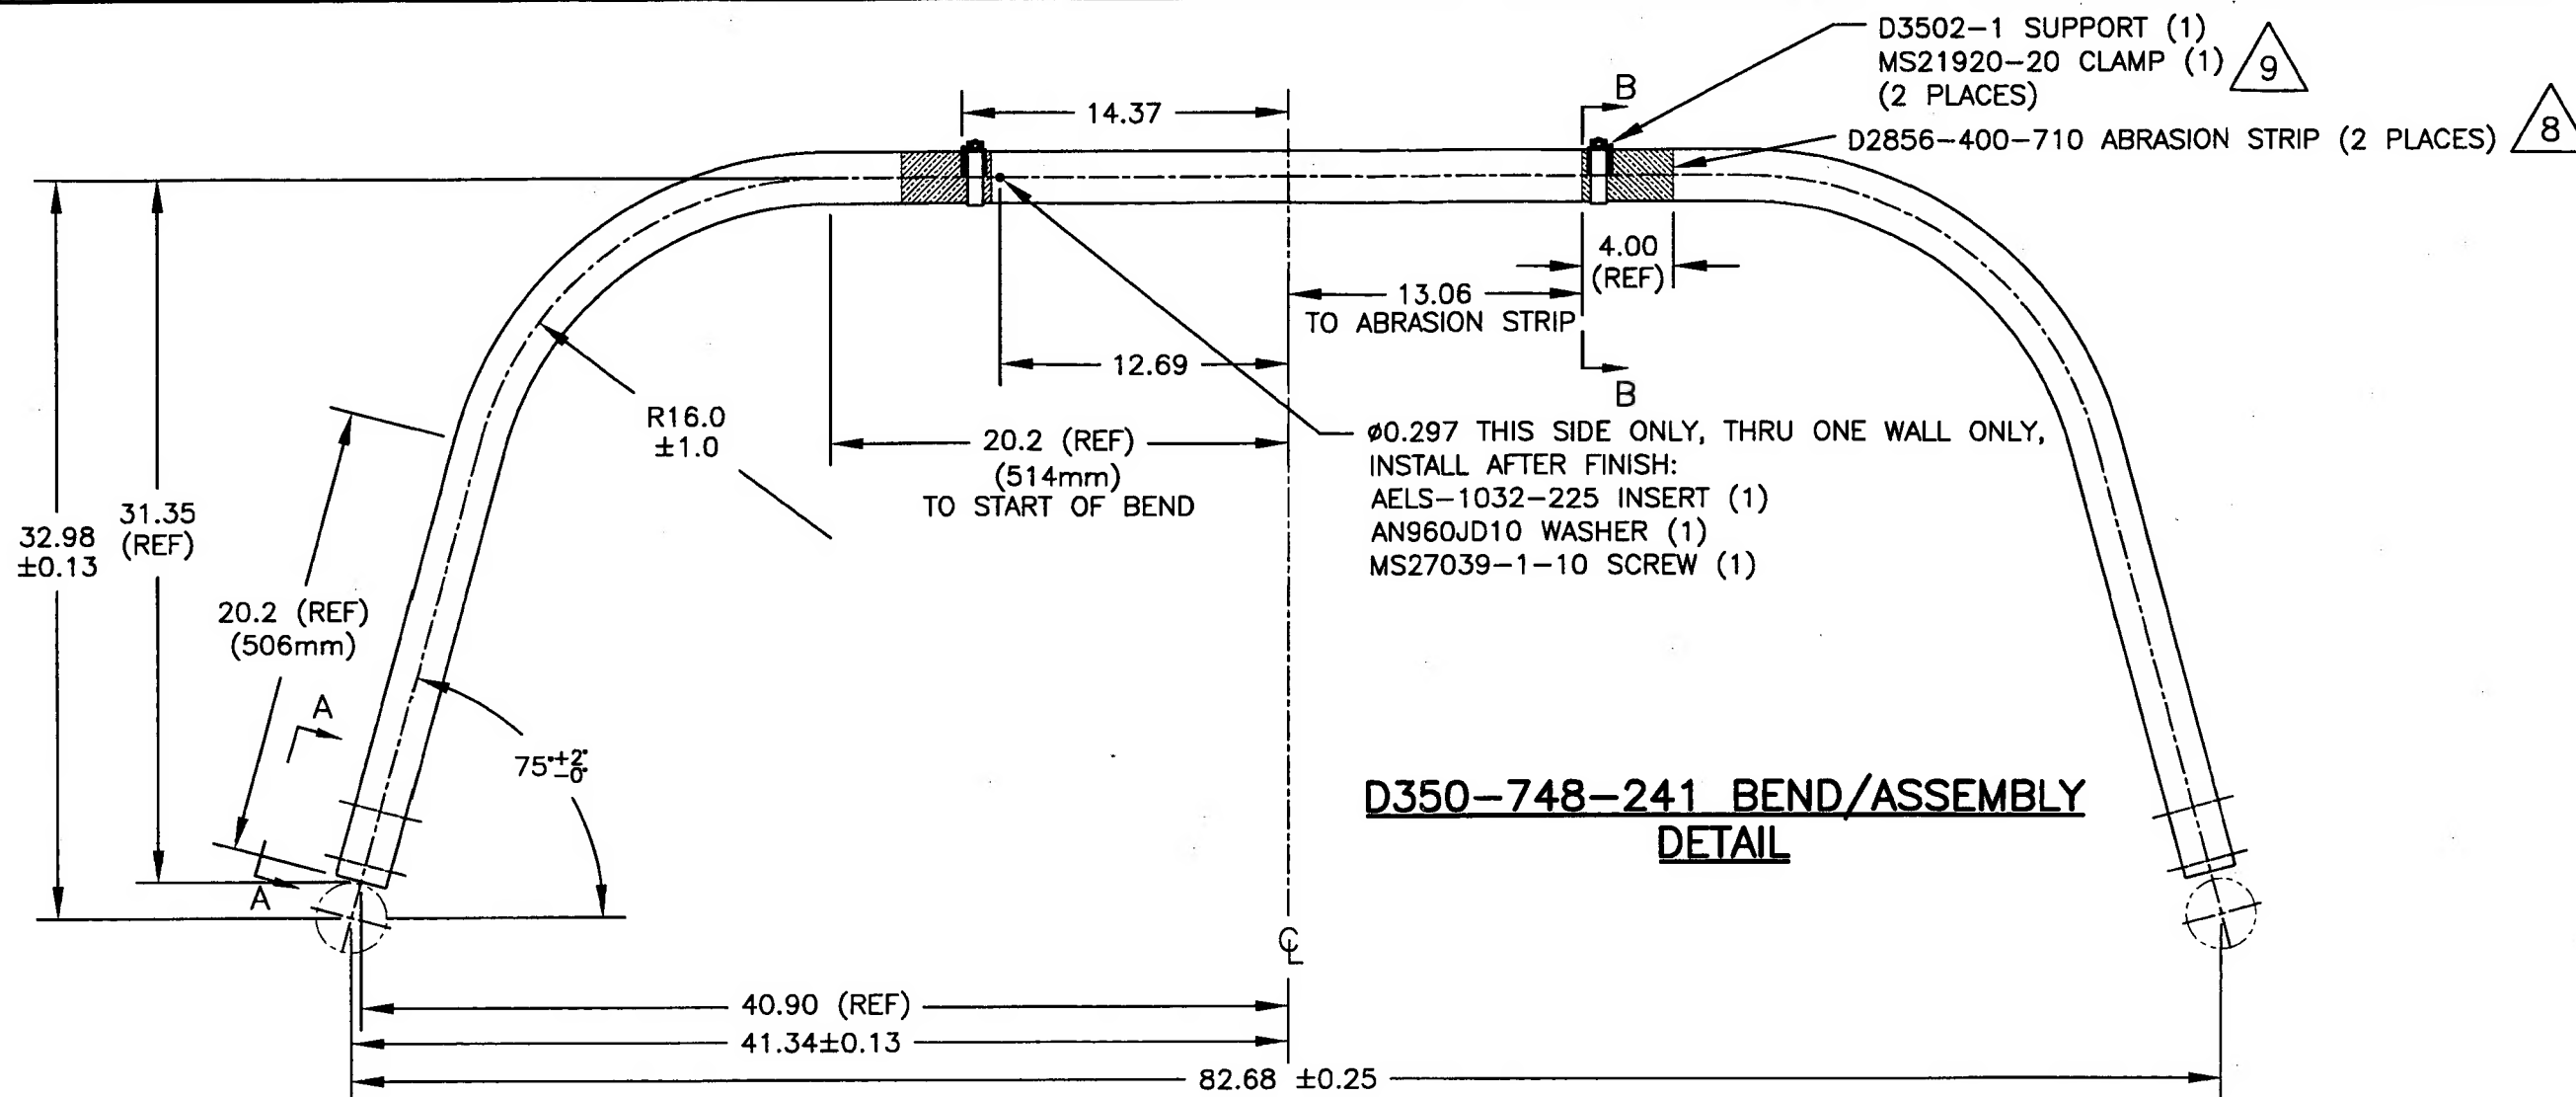

D350-748-241 BEND/ASSEMBLY DETAIL

SECTION B-B SCALE 1:2

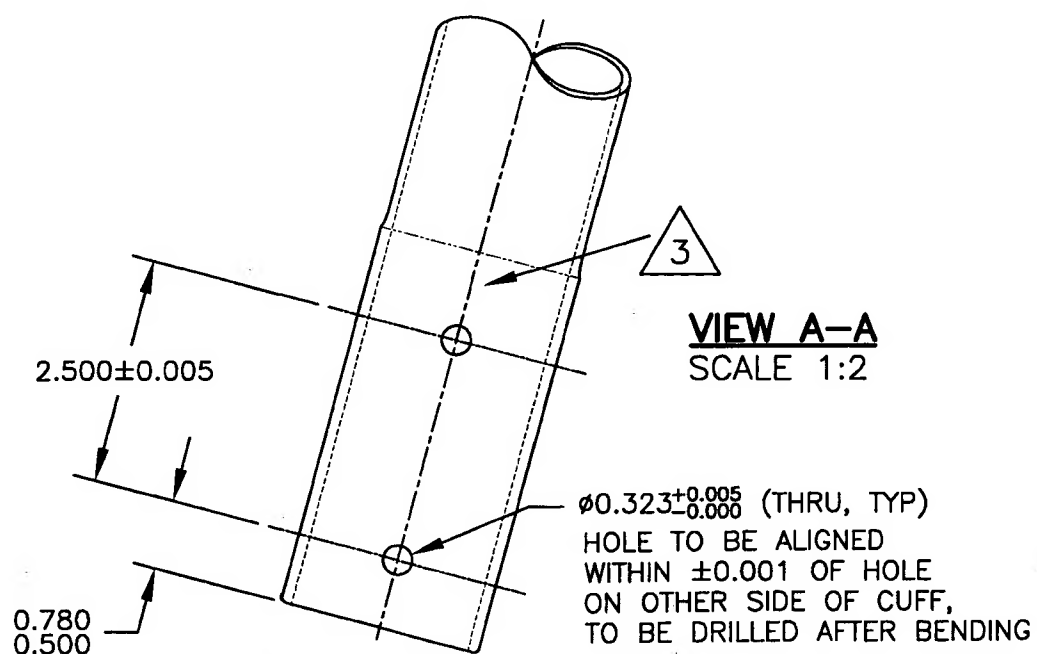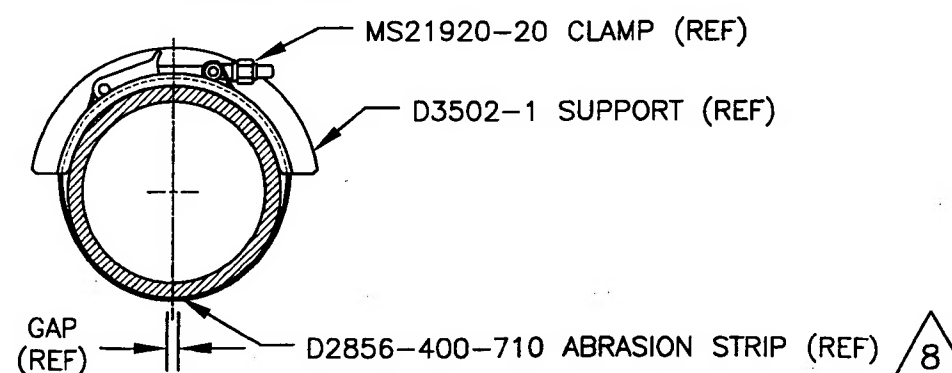

VIEW A-A SCALE 1:2

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40412


UNDER REVIEW
07.02/16
CUFF BEING REDUCED
OK 07.11.22

RELEASED
06.10.31

COPYRIGHT © 2006 BY DART AEROSPACE LTD.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN 90	DRAWN BY 90	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
CHECKED H	APPROVED H	DRAWING NO. D350-748-241	REV. D SHEET 2 OF 3
DATE 06.10.31	TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE 1:8	

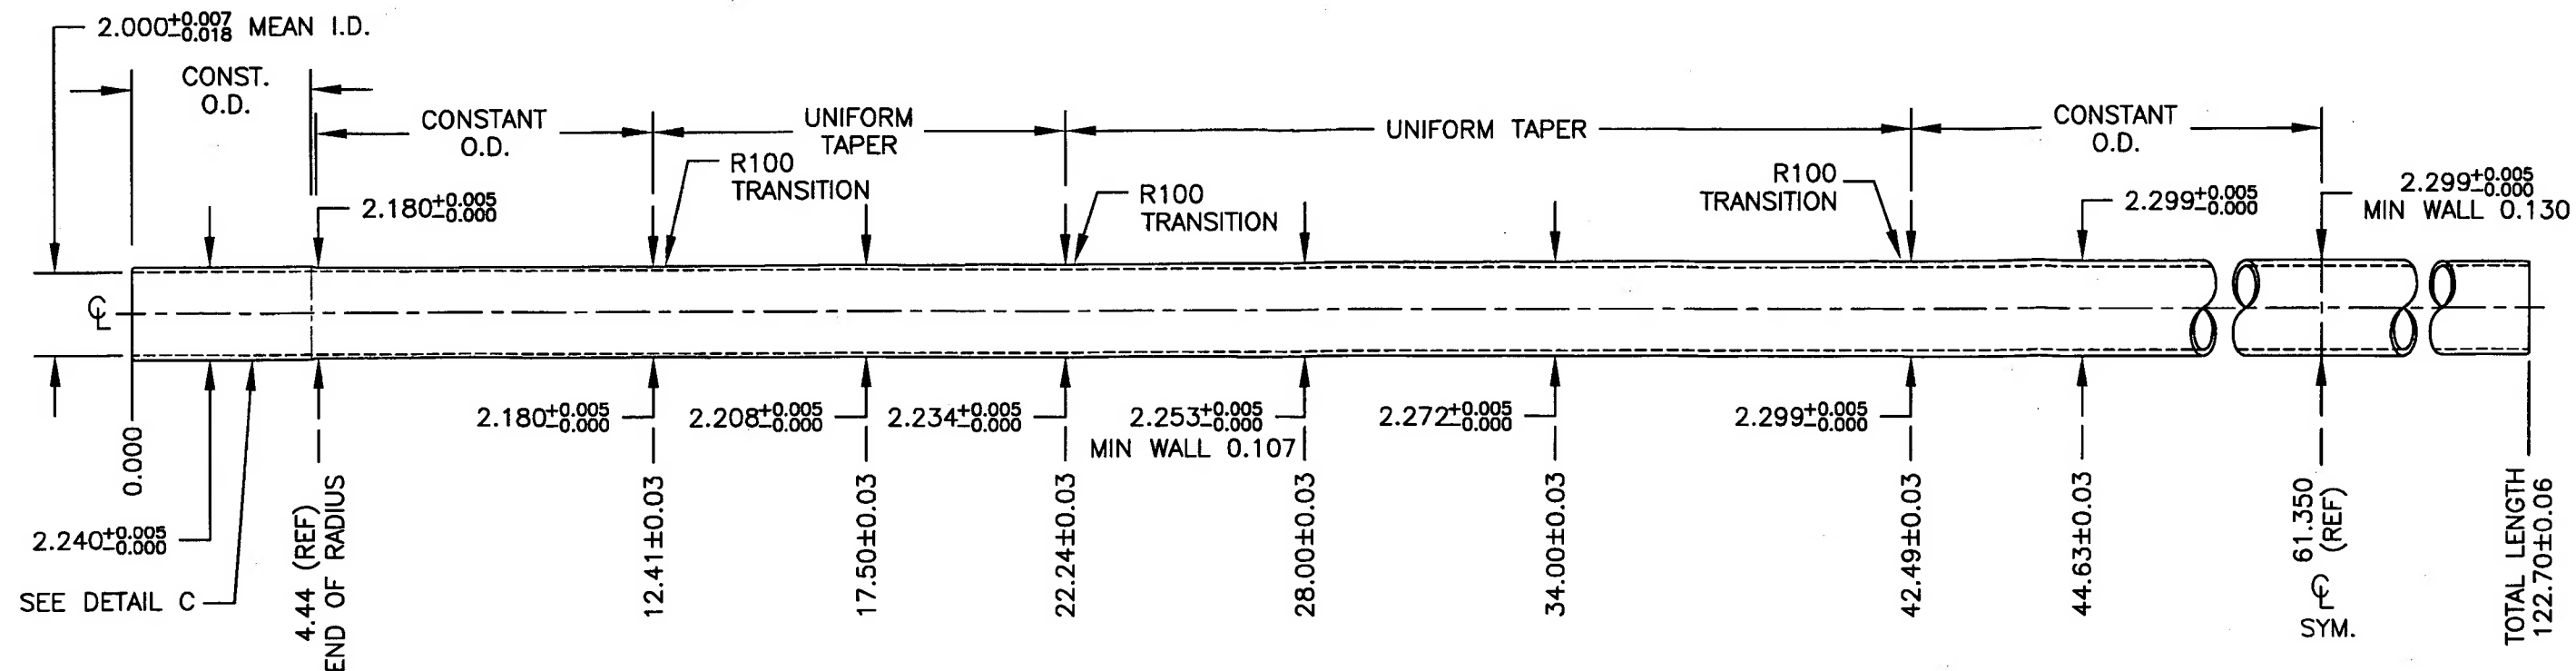

D350-748-241 MACHINING DETAIL

DETAIL C: CUFF
SCALE 1:1

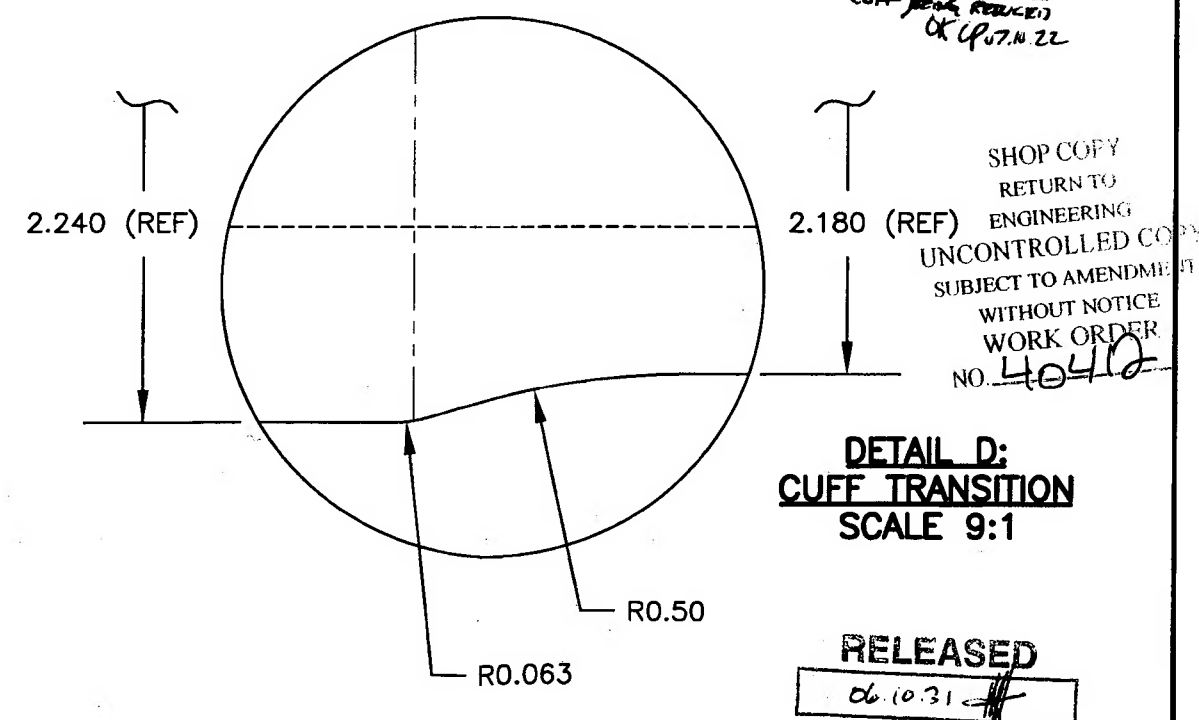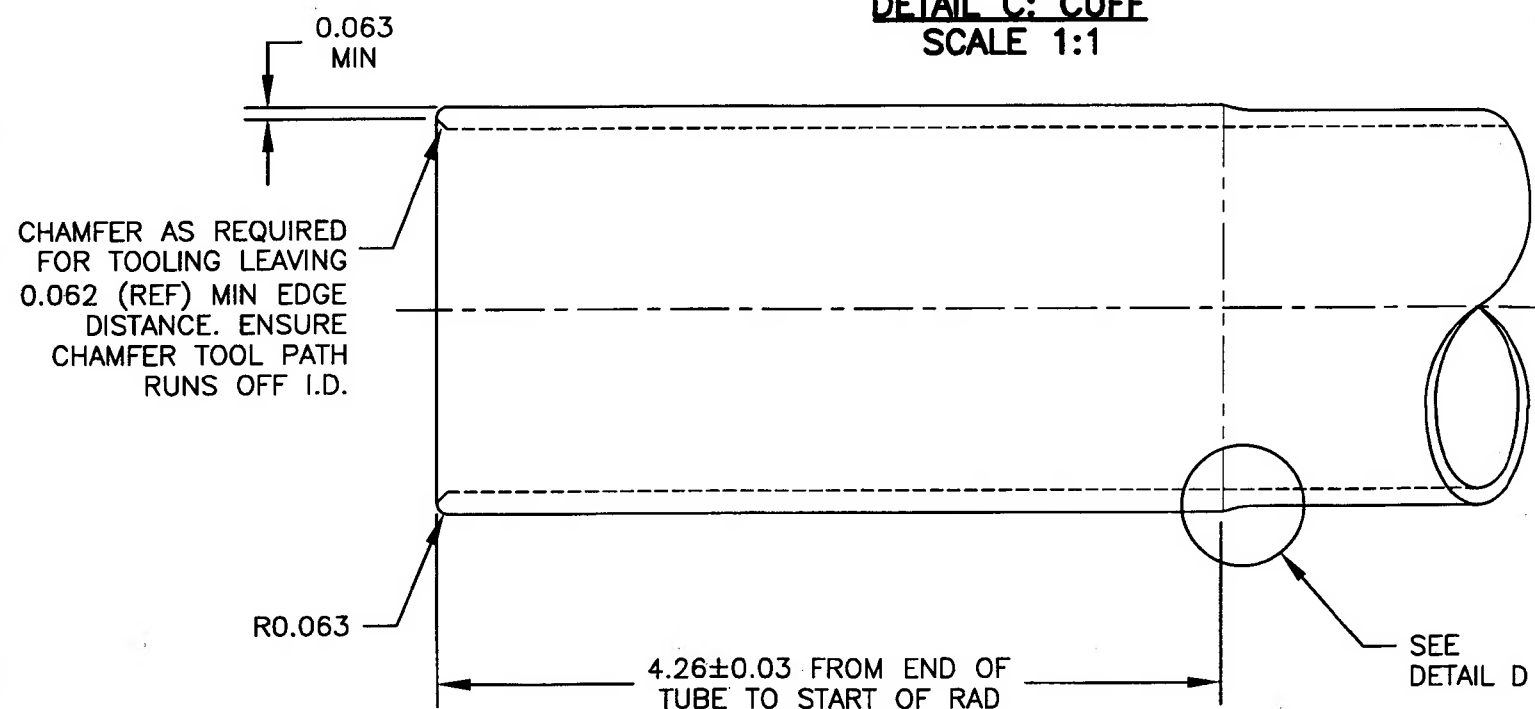

COPYRIGHT © 2006 BY DART AEROSPACE LTD.		DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED <i>[initials]</i>	APPROVED <i>[initials]</i>	DRAWING NO. D350-748-241	REV. D SHEET 3 OF 3
DATE 06.10.31		TITLE CROSSTUBE (AS 350/355 HI AFT)			SCALE 1:4

**CERTIFICATE OF
CONFORMANCE**

**CADORATH PLATING CO. LTD.
2150 LOGAN AVENUE
WINNIPEG, MANITOBA R2J-0J1**

DATE: Jul-31-2008

CONSIGNEE TO: Dart Aerospace Ltd.
1270 Aberdeen St.
Hawksbury, ON K6A 1K7

W/O #: 78311
INVOICE #: 40443

**CONTRACT OR
PURCHASE ORDER #** P00006784

DESCRIPTION: SKID

QTY 1

P/N # D350-748-201

S/N # B40412

**CADMIUM PLATE IAW AMS-QQ-P-416B TYPE 2 CLASS 1. HEAT
CHART #9418 & #9461.**

CERTIFICATE: I certify that the items indicated here on have
been inspected and tested and conform to all specifications
and requirements detailed on the contract or purchase order.

Approved Inspector:

William Parviz

